
TOTO

"TOJA" SHOWER COLUMN SET TX492STN

SPECIFICATIONS

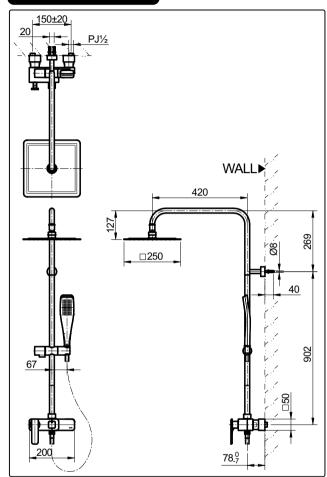


OPERATING CONDITIONS


- 1. Water supply pressure: 0.05 ~ 0.75 MPa.
- 2. Ensure that water supply is clean (No Sand, Dirt, Etc.).


MAINTENANCE

Always wipe chrome plated area with dry soft cloth, and sometimes wipe it with cloth soaked in mild soap.


INSTALLATION

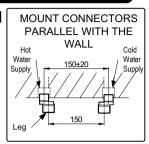


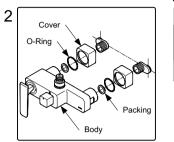


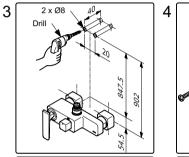

6

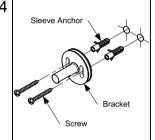

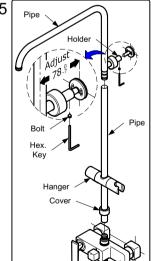


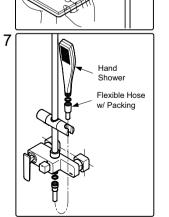

Flowregulator Showe

TROUBLESHOOTING

PROBLEM	CHECK POINT	SOLUTION
Water leaks around the handle	1	Tighten
Handle is loose	2, 3	Tighten

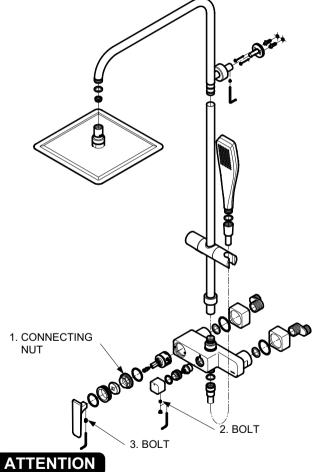

Use of abrasive cleaning material such as; detergents containing hydrochloric acids, thinner, polishing powder, and nylon brush is not recommended.